CINT2000 Result

Copyright ©1999-2005, Standard Performance Evaluation Corporation

Fujitsu Siemens Computers

PRIMERGY TX200 S3, Intel Xeon processor 5120, 1.86 GHz

SPECint_rate2000 = 79.5

SPECint_rate_base2000 = 79.5

SPEC license #: 22 | Tested by: Fujitsu Siemens Computers | Test date: Nov-2006 | Hardware Avail: Jul-2006 | Software Avail: May-2006

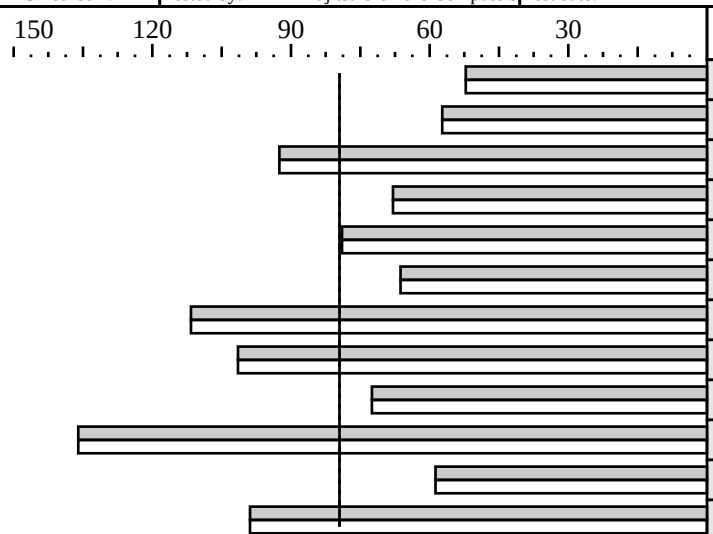

Benchmark	Base Copies	Base Runtime	Base Ratio	Copies	Runtime	Ratio
164.gzip	4	124	52.2	4	124	52.2
175.vpr	4	113	57.3	4	113	57.3
176.gcc	4	55.2	92.5	4	55.2	92.5
181.mcf	4	123	67.9	4	123	67.9
186.crafty	4	58.8	79.0	4	58.8	79.0
197.parser	4	126	66.3	4	126	66.3
252.eon	4	54.0	112	4	54.0	112
253.perlbmk	4	82.3	101	4	82.3	101
254.gap	4	70.4	72.5	4	70.4	72.5
255.vortex	4	64.8	136	4	64.8	136
256.bzip2	4	119	58.7	4	119	58.7
300.twolf	4	141	98.9	4	141	98.9

Hardware

CPU:	Intel Xeon processor 5120 (1.86 GHz, 4MB L2, 1066 MHz system bus)
CPU MHz:	1866
FPU:	Integrated
CPU(s) enabled:	4 cores, 2 chips, 2 cores/chip
CPU(s) orderable:	1,2 chips
Parallel:	No
Primary Cache:	32KB(I) + 32KB(D) on chip, per core
Secondary Cache:	4MB(I+D) on chip, per chip
L3 Cache:	N/A
Other Cache:	N/A
Memory:	4x1GB DDR2-RAM PC2-5300F (CAS 5-5-5)
Disk Subsystem:	Seagate ST336754SS (SAS, 15.4krpm, 36GB)
Other Hardware:	none

Software

Operating System:	Windows Server 2003 Enterprise Edition + SP1 (32-bit)
Compiler:	Intel C++ Compiler 9.1 Build 20060323Z (for 32-bit applications), Microsoft Visual Studio .Net 2003 7.1.3088 (for libraries), SmartHeap Library Version 8.0 from http://www.microquill.com
File System:	NTFS
System State:	Default

Notes/Tuning Information

```
GENERAL
+FDO: PASS1=-Qprof_gen  PASS2=-Qprof_use

Portability flags
   176.gcc:     -Dalloca=_alloca /F10000000
   186.crafty:  -DNT_i386
   253.perlbmk: -DSPEC_CPU2000_NTOS -DPERLDLL /MT
   254.gap:     -DSYS_HAS_CALLOC_PROTO -DSYS_HAS_MALLOC_PROTO

Base tuning flags
   for C programs:   -fast +FDO shlW32M.lib
   for C++ programs: -fast -Qcxx_features +FDO shlW32M.lib

Peak tuning flags
   same as baseline (basepeak=true set globally)

The system bus runs at 1066 MHz

This result was measured with 32-bit binaries using the 32-bit version of
the operating system.
```

Copyright ©1999-2005, Standard Performance Evaluation Corporation

Notes/Tuning Information (Continued)

For information about Fujitsu Siemens Computers in your country please see:
http://www.fujitsu-siemens.com/countries